

CHILOQUIN STATE (2S7) 1 W UTC-8(-7DT) N42°34.76' W121°52.74'

KLAMATH FALLS
L-2J

4221 B TPA-5221(1000) NOTAM FILE MMV
RWY 17-35: H3749X60 (ASPH) S-10 MIRL 0.8% up N
RWY 17: Thld dspldcd 420'. Tree.
RWY 35: Tree.


SERVICE: LGT ACTIVATE MIRL Rwy 17-35-CTAF.
AIRPORT REMARKS: Unattended. Irregular winter maintenance, arpt clsd when covered in snow. Downdraft area north of rwy. West side twy marked with reflectors.

AIRPORT MANAGER: 503-378-4880
COMMUNICATIONS: CTAF 122.9

RADIO AIDS TO NAVIGATION: NOTAM FILE LMT.
KLAMATH FALLS (H) VORTACW 115.9 LMT Chan 106 N42°09.19' W121°43.65' 328° 26.4 NM to fld. 4092/17E. **HIWAS.**

VOR portion unusable:
 050°-060° byd 30 NM blo 12,000'
 060°-120° byd 25 NM blo 12,000'
 170°-195° byd 20 NM
 210°-245° byd 25 NM blo 12,000'
 270°-280° byd 20 NM
 320°-050° byd 23 NM blo 12,000'
 320°-050° byd 30 NM

TACAN AZIMUTH & DME portion unusable:
 105°-125° byd 7 NM blo 12,000'
 153°-195° byd 20 NM blo 11,000'
 210°-305° byd 25 NM blo 10,500'
 320°-105° byd 13 NM blo 13,000'
 320°-125° byd 20 NM

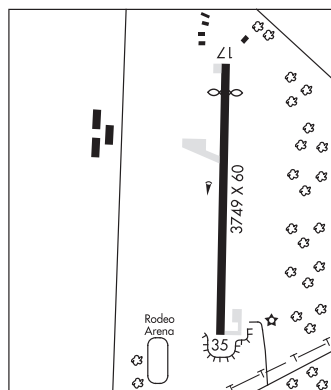

CHRISTMAS VALLEY (62S) 1 SE UTC-8(-7DT) N43°14.18' W120°39.88'

KLAMATH FALLS
H-1B, L-11A


4320 B NOTAM FILE MMV
RWY 07-25: H5200X60 (ASPH) S-12 MIRL
RWY 07: Tree.

RWY 25: PAPI(P2L)-GA 3.0° TCH 39'. Bldg.
SERVICE: LGT ACTIVATE MIRL Rwy 07-25 and PAPI Rwy 25-CTAF.
AIRPORT REMARKS: Unattended.

AIRPORT MANAGER: 541-576-2216
COMMUNICATIONS: CTAF/UNICOM 122.8

RADIO AIDS TO NAVIGATION: NOTAM FILE LKV.
LAKEVIEW (H) VORTACW 112.0 LKV Chan 57 N42°29.57' W120°30.43' 332° 45.1 NM to fld. 7460/19E. **HIWAS.**

COMM/NAV/WEATHER REMARKS: UNICOM monitored irregularly.

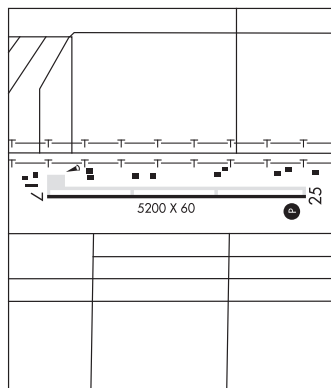

CLEARWATER

TOKETEETEE STATE (3S6) 2 S UTC-8(-7DT) N43°13.41' W122°25.27'

KLAMATH FALLS

3361 NOTAM FILE MMV
RWY 11-29: 5350X60 (TURF) 2.4% up SE
RWY 11: Trees.
RWY 29: Trees.

AIRPORT REMARKS: Unattended. Arpt CLOSED from 1 Nov-1 May. Elk, deer and turkey on and invof arpt. Arpt on West side of Cascades and affected by wx West. Best info on arpt thru US Forest svc Roseburg, or lcl FBO at Roseburg. Rwy 11-29 graded, 60' wide, shoulders rough and rutted. Rwy 11-29 has +120' trees 250' either side of centerline. Rwy 11-29 thlds outlined with white tires. Trees 4'-30' along south side of rwy within 50' of centerline.

AIRPORT MANAGER: 503-378-4880
COMMUNICATIONS: CTAF 122.9

COLUMBIA GORGE RGNL/THE DALLES MUNI (See THE DALLES on page 165)