

WENATCHEE**PANGBORN MEM** (EAT)(KEAT) 4 E UTC-8(-7ZDT) N47°23.93' W120°12.41'

SEATTLE

1249 B Class I, ARFF Index A NOTAM FILE EAT

H-1C, L-1D, 13A

RWY 12-30: H7000X150 (ASPH) S-75, D-100, 2S-97, 2D-250 MIRL

IAP, AD

RWY 12: REIL. PAPI(P4L)—GA 3.6° TCH 58'. Road. Rgt tfc.**RWY 30:** RAIL. REIL. PAPI(P2L)—GA 4.3° TCH 46'.**RWY 07-25:** H4460X75 (ASPH) S-50, D-77, 2S-97, 2D-136
1.0% up SE**RWY 07:** Tree. Rgt tfc.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 07:** TORA-4460 TODA-4460 ASDA-4460 LDA-4460**RWY 12:** TORA-5700 TODA-5700 ASDA-5700 LDA-5700**RWY 25:** TORA-4460 TODA-4460 ASDA-4460 LDA-4460**RWY 30:** TORA-5700 TODA-5700 ASDA-5700 LDA-5700**SERVICE:** S4 FUEL 100LL, JET A OX 1, 2 LGT PAPI Rwy 12 and Rwy 30 opr continuously. ACTIVATE MIRL Rwy 12-30, REIL Rwy 12 and Rwy 30—CTAF.**AIRPORT REMARKS:** Attended 1600-0200Z. Rwy 07-25 clsd UFN. Rwy 07-25 has extv cracks, vegetation, and sfc deterioration. Cold temperature restricted airport. Altitude correction required at or below -7C/19F. 24 hr PPR for unscheduled air carrier ops with more than 30 pax seats call arpt ops, 509-860-1852. Bird hazard. Glider activity from Mar-Nov. Ldg fee.**AIRPORT MANAGER:** 509-884-2494**WEATHER DATA SOURCES:** ASOS 119.925 (509) 886-4226.**COMMUNICATIONS:** CTAF/UNICOM 123.0

WENATCHEE RCO 122.6 (SEATTLE RADIO)

SEATTLE CENTER APP/DEP CON 126.1

AIRSPACE: CLASS E**RADIO AIDS TO NAVIGATION:** NOTAM FILE EAT.**WENATCHEE (L) VOR/DME** 111.0 EAT Chan 47 N47°23.98' W120°12.65' at fld. 1222/15E.

VOR/DME unusable:

073°-118° byd 25 NM blo 5,500'

118°-153° byd 15 NM blo 14,500'

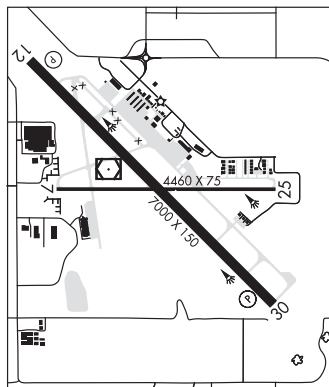
153°-243° byd 15 NM

243°-263° byd 35 NM blo 12,000'

290°-303° byd 14 NM blo 7,900'

303°-073° byd 20 NM

ILS/DME 109.35 I-ADJ Chan 30(Y) Rwy 12. Class IE. LOC unusable byd 15 NM blo 5,700'. DME unmonitored.

**WESTPORT** (14S) 1 N UTC-8(-7ZDT) N46°53.82' W124°06.04'

SEATTLE

14 B NOTAM FILE SEA

RWY 12-30: H2318X50 (ASPH) MIRL**RWY 12:** PAPI(P2L). Trees.**RWY 30:** PAPI(P2L). Rgt tfc.**AIRPORT REMARKS:** Unattended. Large bird nesting area adjacent to Rwy 12-30. Rwy 12-30 soft shoulders.**AIRPORT MANAGER:** 360-268-0131**COMMUNICATIONS:** CTAF 122.9**WHATCOM** N48°56.72' W122°34.76' NOTAM FILE BLI.

SEATTLE

(H) VORTACW 113.0 HUH Chan 77 150° 9.3 NM to Bellingham Intl. 83/20E. HIWAS.

H-1B, L-1E

TACAN AZIMUTH should be:

155°-165° byd 15 NM blo 6,000'

WHIDBEY AIR PARK (See LANGLEY on page 187)