

CALDWELL INDUSTRIAL (EUL)(KEUL) 3 SE UTC-7(-6DT) N43°38.51' W116°38.15'

SALT LAKE CITY

2432 B NOTAM FILE EUL

H-1C, L-11B

RWY 12-30: H5500X100 (ASPH) S-72, D-86, 2S-109 MIRL

IAF

RWY 12: PAPI(P4L)—GA 3.0° TCH 42'. Road.**RWY 30:** PAPI(P4L)—GA 3.0° TCH 45'. Rgt tfc.**SERVICE:** S4 **FUEL** 100LL, JET A **LGT** ACTIVATE MIRL Rwy

12-30—CTAF. PAPI Rwy 12 and Rwy 30 opr continuously.

AIRPORT REMARKS: Attended Mar-Oct 1500-0200Z, Nov-Feb 1500-0000Z. Parachute Jumping. Fuel avbl 24 hrs by credit card. Jet A from truck Mon-Sat 1500-2300Z. Call 208-453-8577 for Jet A and after hrs call out. Preferred parking for jet and large turboprop acft avbl on terminal apron on north side of rwy. Transient ramp preferred for use by training helicopters for launch and recovery. Preferred helicopter pattern SW of rwy. Rwy 12 calm wind rwy. + 363' radio twr located 1.4 miles north of arpt.

AIRPORT MANAGER: 208-459-9779**WEATHER DATA SOURCES:** AWOS-3PT 135.075 (208) 454-3953.**COMMUNICATIONS:** CTAF/UNICOM 122.7**SQUAW BUTTE RCO** 122.45 (BOISE RADIO)® **BIG SKY APP/DEP CON** 119.6**RADIO AIDS TO NAVIGATION:** NOTAM FILE BOI.**BOISE (H) VORTACW** 113.3 BOI Chan 80 N43°33.17'

W116°11.53' 269° 20.1 NM to fld. 2876/17E.

VOR portion unusable:

001°-044° byd 22 NM blo 11,000'

001°-044° byd 32 NM blo 14,500'

045°-071° byd 32 NM blo 12,500'

072°-084° byd 32 NM blo 10,500'

TACAN AZIMUTH & DME portion unusable:

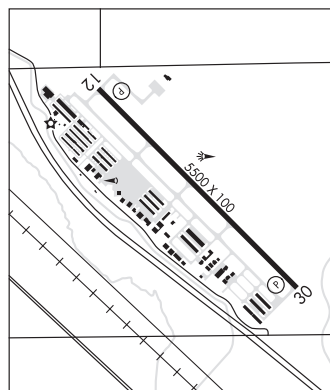
010°-060° byd 12 NM blo 13,000'

010°-060° byd 27 NM blo 15,500'

113°-155° byd 30 NM blo 7,000'

348°-010° byd 20 NM blo 13,000'

348°-010° byd 27 NM blo 15,500'

MERIDIAN NDB (MHW) 238 MPA N43°36.20' W116°32.34' 283° 4.8 NM to fld.**CAMAS CO** (See FAIRFIELD on page 45)**CAREY****CAREY** (U65) 0 E UTC-7(-6DT) N43°18.53' W113°56.16'

SALT LAKE CITY

4789 NOTAM FILE BOI

RWY 08-26: 2650X170 (TURF) 0.3% up W**RWY 08:** Fence.**RWY 26:** Fence.**AIRPORT REMARKS:** Unattended. Recommend land Rwy 26, tkf Rwy 08 when wind cond permit. Be alert for sprinklers on rwy.

Rwy 08-26 edges and thlds marked with conc markers. Numerous 30' to 90' trees at 900' to 1200' from EOR 08.

AIRPORT MANAGER: 208-309-0319**COMMUNICATIONS:** CTAF 122.9**HOLLOW TOP** (ØU7) 18 E UTC-7(-6DT) N43°19.43' W113°35.43'

SALT LAKE CITY

5359 NOTAM FILE BOI

RWY 05-23: 2500X140 (TURF) 1.1% up NE**RWY 23:** Road.

AIRPORT REMARKS: Unattended. No winter maintenance. Animals on and invof arpt. No line of sight btn rwy ends. Rwy 05-23 sfc may be poor due to damage by livestock, gnd vehicles and rodents. +3' sagebrush adjacent to both edges of rwy. Rwy 05-23 edges and thlds marked with white rocks.

AIRPORT MANAGER: 208-334-8775**COMMUNICATIONS:** CTAF 122.9